

Gomito orientabile

Serie leggera e serie pesante

Swivel elbows

Light range and heavy range

Einstellbare Winkelverschraubungen


Leichte Baureihe und Schwere Baureihe

Coudes orientables

Série légère et série lourde

Codo orientables, ejecucion macho

Serie ligera y serie pesada

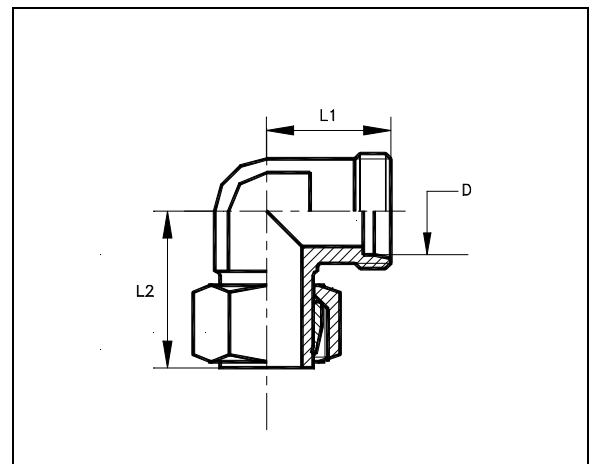

Serie	Ø Tubo D	L1	L2		TAA
L	6	19	26	T-EVW 6-L	11800018
	8	21	27	T-EVW 8-L	11805018
	10	22	28.5	T-EVW 10-L	11810018
	12	24	29	T-EVW 12-L	11815018
	14	28	32	T-EVW 14-L	11816018
	15	28	32	T-EVW 15-L	11820018
	16	28	32	T-EVW 16-L	11866018
	18	31	35	T-EVW 18-L	11825018
	20	37	44	T-EVW 20-L	11826018
	22	35	38	T-EVW 22-L	11830018
	28	38	41.5	T-EVW 28-L	11835018
	35	45	51	T-EVW 35-L	11840018
	42	51	56	T-EVW 42-L	11845018
S	6	23	27	T-EVW 6-S	11850018
	8	24	27	T-EVW 8-S	11855018
	10	25	29.5	T-EVW 10-S	11860018
	12	29	30.5	T-EVW 12-S	11865018
	14	30	34.5	T-EVW 14-S	11870018
	16	33	36	T-EVW 16-S	11875018
	20	37	44	T-EVW 20-S	11880018
	25	42	49.5	T-EVW 25-S	11885018
	30	49	55	T-EVW 30-S	11890018
	38	57	63	T-EVW 38-S	11895018

Istruzione di montaggio

1. Oleare i filetti d'estremità e le 2 O-ring.
2. Infilare la vite inferiore nel corpo del raccordo ed avvitare a mano.
3. Orientare il lato collegamento tubo e serrare la vite con la coppia di serraggio prescritto (vedere generalità, controbilanciando il corpo del raccordo)
4. Montare il tubo, controbilanciando il corpo del raccordo.
5. Mettere il tappo e serrare con la coppia prescritta (mass. _ giro).
6. Si può smontare e rimontare il raccordo senza limitazioni.
Verificare lo stato degli anelli torici e sostituire se necessario.

Attenzione : Un montaggio non conforme (lubrificazione o danneggiamento dell'O-ring superiore) riduce la pressione nominale e la durata della guarnizione con rischio di perdite.

Assembly instructions

1. Oil the threads and the 2 O-ring.
2. Insert the bolt into the banjo and tighten by hand.
3. Set the tube connection to the desired direction and tighten the bolt with the recommended tightening torque (see Technical notes) holding the banjo firmly by means of a spanner.
4. Fix the tube holding the banjo firmly by means of a spanner.
5. Set the blanking plug and tighten with the recommended tightening torque (max. _ of turn) holding the body of the coupling firmly by means of a spanner.
6. Repeated reassembly is possible. Check seals for possible damage and replace if necessary.

Attention : Different assembly (lubrication or damaging of the O-rings) reduces the nominal pressure rating and the life of the coupling, causing leakages.